

PRACTICE EXAM 15: ASE T2

SIMULATION

DOMAIN A — GENERAL ENGINE DIAGNOSIS (Questions 1–11)

1. A driver reports that his heavy-duty diesel produces a distinct tapping noise at idle. Before any repair is attempted, the technician should:

- A. Replace the valve cover gasket
- B. Adjust all valve lash
- C. Change the engine oil
- D. Verify the complaint by listening to the engine under the described conditions

2. A Class 8 tractor arrives at the shop with a complaint of progressive power loss. Measurements show boost at 12 psi against a 30 psi specification. Exhaust back pressure reads 7 psi (spec 4 max). The MOST likely fault location is:

- A. The aftertreatment system downstream of the turbocharger
- B. The air filter element
- C. The fuel injection rail
- D. The charge air cooler fins

3. An oil analysis report shows sodium, potassium, and boron all elevated simultaneously. This pattern indicates:

- A. Normal additive depletion

- B. Air intake contamination
- C. Coolant contamination of the engine oil
- D. Ring wear accelerating

4. A scan tool freeze frame captures:

- A. Coolant freezing point
- B. Engine operating parameters at the moment a DTC was first detected
- C. Battery voltage history over 30 days
- D. Calibration version information

5. A heavy-duty diesel engine produces white smoke that persists after warmup and intensifies under load. The MOST likely cause is:

- A. Normal cold-start behavior
- B. Low cetane fuel
- C. Worn piston rings
- D. Coolant entering the combustion chamber

6. A cylinder cutout test shows one cylinder producing no measurable RPM drop when disabled. This result indicates:

- A. The cylinder was not contributing before cutout
- B. The scan tool is malfunctioning
- C. Normal variation
- D. The cylinder is producing full power

7. A heavy-duty diesel produces a knock loudest at low RPM and synchronized with firing frequency. This description matches:

- A. Valve train clatter
- B. Rod bearing knock intensifying at low speeds
- C. Exhaust manifold leak
- D. Normal combustion noise

8. Oil analysis shows silicon rising from 18 to 82 ppm with iron normal. The MOST likely cause is:

- A. Fuel contamination
- B. Normal wear
- C. Dirt ingestion from a leaking air intake
- D. Coolant contamination

9. A Class 8 tractor has been derated to 5 mph with inducement countdown active. This condition is triggered by:

- A. Low engine oil level
- B. Low battery voltage
- C. Transmission failure
- D. A persistent emissions-related fault in the aftertreatment system

10. A customer reports gradual power loss over weeks. Boost, rail pressure, and back pressure measure within specification. The next area to investigate is:

- A. The aftertreatment system, DPF loading, SCR function, and DEF quality
- B. Battery voltage

- C. Engine oil viscosity
- D. Coolant hose condition

11. A stored DTC on a heavy-duty diesel ECM with MIL illuminated and no driveability complaint requires:

- A. Clearing the code and returning the truck
- B. Diagnosing the root cause and repairing
- C. Replacing the ECM
- D. Ignoring the code

DOMAIN B — CYLINDER HEAD AND VALVE TRAIN (Questions 12–15)

12. A cylinder head warpage reading of 0.009 inches against a 0.004-inch specification requires:

- A. Installing a thicker gasket
- B. Reinstalling as-is
- C. Resurfacing within OEM material removal limits
- D. Ignoring the measurement

13. Head bolts on modern heavy-duty diesels are almost universally:

- A. Torque-to-yield fasteners requiring replacement after removal
- B. Reusable standard-torque bolts
- C. Hand-tightened studs
- D. Self-locking bolts that never need replacement

14. A valve rotator that has stopped functioning should be:

- A. Repaired in place
- B. Replaced to prevent localized valve face burning
- C. Reused during current rebuild
- D. Ignored since valves rotate naturally

15. Valve stem-to-guide clearance above specification will:

- A. Improve oil distribution
- B. Reduce oil consumption
- C. Have no effect on operation
- D. Allow oil down the stem and impair seal function

DOMAIN C — ENGINE BLOCK (Questions 16–20)

16. A connecting rod with a bent condition has been identified. Before installing a replacement:

- A. Investigate what caused the original rod to bend
- B. Install oversize bearings
- C. Replace the crankshaft
- D. Increase oil pressure

17. Cylinder liner protrusion uniformity around the circumference is critical because:

- A. It affects compression ratio
- B. It affects coolant flow rate

- C. Uneven protrusion produces uneven gasket crush and potential failure
- D. It affects piston ring end gap

18. Block deck flatness inspection requires:

- A. A caliper only
- B. Hand feel along the surface
- C. A standard ruler and paper
- D. A precision straightedge and feeler gauges at multiple points

19. Out-of-round on a crankshaft main journal is the difference between:

- A. Journal length and diameter
- B. Perpendicular diameter measurements at the same axial position
- C. Journal diameter and bearing diameter
- D. Axial measurements at the same angle

20. A forged steel monobloc piston is preferred for heavy-duty service because:

- A. It provides superior thermal durability at the crown
- B. It is lighter than aluminum
- C. It costs less to produce
- D. It is easier to install

DOMAIN D — LUBRICATION AND COOLING (Questions 21–26)

21. Low oil pressure at idle that recovers at 1,800 RPM is the classic signature of:

- A. A failed oil pump
- B. A stuck pressure relief valve
- C. Excessive oil viscosity
- D. Worn main or rod bearings

22. A coolant pressure test shows 15 psi dropping to 9 psi over 15 minutes with no visible external leak. The MOST likely cause is:

- A. Normal coolant expansion
- B. A loose radiator hose
- C. An internal leak into combustion chamber or crankcase
- D. A failed pressure cap

23. Supplemental coolant additive (SCA) replenishes:

- A. Nitrite-based cavitation inhibitors
- B. Ethylene glycol for freeze protection
- C. Water pump lubricant
- D. Coolant dye

24. Engine oil typically runs at what temperature relationship to coolant at rated load?

- A. Equal to coolant temperature

- B. 50°F below coolant
- C. 100°F higher than coolant
- D. 10 to 20°F higher than coolant

25. A brown emulsion on top of the coolant in the surge tank indicates:

- A. Normal coolant condition
- B. Internal oil cooler leak with oil migrating into coolant
- C. Excessive SCA concentration
- D. Air in the cooling system

26. Oil-in-coolant without reverse contamination MOST commonly indicates:

- A. Head gasket failure
- B. Cracked cylinder head
- C. Worn piston rings
- D. Oil cooler internal leak

DOMAIN E — AIR INDUCTION AND EXHAUST (Questions 27–32)

27. A turbocharger with shaft radial play at 0.040 inches where specification is 0.020 max indicates:

- A. Bearing wear beyond serviceable limits
- B. Normal operation
- C. New turbocharger condition
- D. Thermal expansion only

28. An air intake leak between the filter and turbocharger admits:

- A. Coolant into the compressor
- B. Exhaust into the intake
- C. Unfiltered dust eroding the compressor wheel
- D. Oil into the combustion chamber

29. A VGT stuck in the fully closed position at high RPM produces:

- A. Improved fuel economy
- B. Excessive back pressure and potential turbocharger overspeed
- C. Reduced boost
- D. Normal operation

30. Exhaust back pressure at rated load on a heavy-duty diesel should normally be below:

- A. 25 psi
- B. 15 psi
- C. 40 psi
- D. 5 psi

31. A charge air cooler contaminated with oil from a failed compressor-side seal must be:

- A. Cleaned or replaced before installing a new turbocharger
- B. Painted externally
- C. Pressure-tested only
- D. Ignored and left in place

32. Active DPF regeneration is commanded when:

- A. Ambient temperature falls below freezing
- B. The engine reaches idle
- C. Accumulated DPF soot exceeds the passive regeneration threshold
- D. Vehicle speed exceeds a programmed limit

DOMAIN F — FUEL SYSTEM (Questions 33–48)

33. A heavy-duty diesel HPCR system has rail pressure reaching only 12,000 psi against commanded 26,000 psi. Lift pump output measures 28 psi (spec 45–60). The FIRST diagnostic step is:

- A. Investigate the low-pressure supply system
- B. Replace all injectors
- C. Replace the HP pump
- D. Update the ECM calibration

34. Technician A says EUI injectors use cam-driven plungers. Technician B says HEUI injectors use high-pressure engine oil on a hydraulic intensifier. Who is correct?

- A. Technician A only
- B. Both Technician A and Technician B
- C. Technician B only
- D. Neither Technician A nor Technician B

35. A water-in-fuel warning has illuminated. The correct response is:

- A. Clear the warning and continue driving

- B. Replace the fuel filter element
- C. Add an anti-gel additive
- D. Safely stop and drain the water from the separator bowl

36. HPCR injector calibration codes must be programmed into the ECM because:

- A. The ECM compensates for individual injector flow characteristics
- B. The codes prevent unauthorized installation
- C. The codes confirm warranty coverage
- D. The codes activate injector electronics

37. A pilot injection event on an HPCR engine delivers approximately:

- A. 30 percent of total cycle fuel
- B. 50 percent of total cycle fuel
- C. 2 to 5 percent of total cycle fuel
- D. 85 percent of total cycle fuel

38. An injector return flow test shows one injector at 50 mL/min against peers at 15 mL/min. This indicates:

- A. Normal variation
- B. Excessive internal injector leakage
- C. Under-fueling condition
- D. A plugged return line

39. On an HEUI system, the Injection Control Pressure (ICP) sensor monitors:

- A. Fuel rail pressure
- B. Battery voltage
- C. Coolant pressure
- D. High-pressure engine oil supplied to injectors

40. Biodiesel B20 introduced to an engine previously running petroleum diesel may cause:

- A. Premature fuel filter plugging from dissolved deposits
- B. Increased cetane rating
- C. Reduced emissions only
- D. Improved fuel economy

41. Primary fuel filters on heavy-duty diesels typically filter at:

- A. 2 microns
- B. 1 micron
- C. 10 to 30 microns nominal
- D. 100 microns

42. An HPCR pressure control valve stuck closed produces:

- A. Reduced rail pressure
- B. Rail pressure climbing to HP pump maximum output
- C. Normal operation
- D. Improved engine efficiency

43. Fuel with a cloud point of 22°F operated at 0°F ambient will:

- A. Improve cold-start performance
- B. Increase cetane rating
- C. Boil in the injection pump
- D. Form wax crystals that plug fuel filters

44. Fuel temperature affects injection quantity because:

- A. Cold fuel cannot flow
- B. Hot fuel ignites at lower temperatures
- C. Fuel density changes with temperature
- D. Fuel viscosity determines cetane rating

45. An EUI injector requires:

- A. Compressed brake air
- B. Cam-driven plunger motion with ECM solenoid control
- C. High-pressure oil from a rail
- D. Coolant flow through the injector

46. A fuel tank vent blocked by debris will:

- A. Improve fuel economy
- B. Reduce fuel contamination
- C. Create tank vacuum, progressively starving the engine
- D. Have no operational effect

47. A pilot injection is typically delivered:

- A. At TDC exactly
- B. 15 to 25 degrees BTDC to initiate combustion before main injection
- C. 45 to 60 degrees BTDC
- D. 30 to 40 degrees ATDC

48. On a common rail injection system, which component physically stores pressurized fuel between injection events?

- A. The high-pressure pump
- B. Each injector internally
- C. The pressure control valve
- D. The common rail acting as a pressure accumulator

DOMAIN G — STARTING AND CHARGING (Questions 49–52)

49. A heavy-duty diesel cranks slowly. Battery voltage is 12.4V. Voltage drop across the positive cable during cranking reads 1.1V (spec 0.5V max). The MOST likely cause is:

- A. Excessive resistance in the cable or terminals
- B. Discharged batteries
- C. Failed starter motor
- D. Failed alternator

50. A parallel-wired battery pack has three batteries at 12.6V and one at 12.0V. The low-reading battery is:

- A. Fully charged
- B. Over-charged
- C. Approaching failure with a possible bad cell
- D. Normal variation

51. A starter motor armature spins freely but does not crank the engine. The MOST likely cause is:

- A. Discharged battery
- B. Worn starter drive or pinion
- C. Failed voltage regulator
- D. Blown starter fuse

52. An AC ripple reading of 800 mV on alternator output (spec below 100 mV) indicates:

- A. Slipping drive belt
- B. Failed voltage regulator
- C. Failed rectifier diodes
- D. Discharged battery

DOMAIN H — ENGINE BRAKES (Questions 53–55)

53. Compression-release engine brakes use engine oil pressure to:

- A. Lubricate the brake housing
- B. Monitor brake electronic status
- C. Hydraulically actuate the master and slave piston circuit
- D. Cool the brake mechanism

54. An exhaust brake produces braking effort by:

- A. A butterfly valve restricting exhaust flow
- B. Opening exhaust valves near TDC
- C. Reducing fuel injection quantity
- D. Activating the alternator

55. Dashboard brake level switches labeled LOW, MEDIUM, HIGH typically control:

- A. Exhaust temperature during braking
- B. The number of cylinders activated for braking
- C. Transmission gear selection
- D. Engine RPM ceiling during braking

PRACTICE EXAM 15: ANSWER KEY AND EXPLANATIONS

1. D — Verifying the complaint under the exact conditions described is always the first diagnostic step. Listening to the engine at idle under the specific conditions the driver reported confirms the symptom and provides the baseline for further diagnosis. Parts replacement before verification frequently leads to misdiagnosis.
2. A — Low boost combined with elevated exhaust back pressure points to the aftertreatment system downstream of the turbocharger. The restriction prevents the turbine from developing rated speed, so boost falls short while back pressure rises. This signature pattern is specifically diagnostic of aftertreatment-side restriction.
3. C — Sodium, potassium, and boron are the signature chemical elements of heavy-duty coolant additive packages. When all three rise simultaneously in an oil sample, coolant has entered the oil — typically from a head gasket, cracked head/block, or oil cooler failure.
4. B — Freeze frame data is the scan tool capture that records engine parameters — RPM, load, temperatures, pressures — at the exact moment a DTC was first detected. This contextual information is often more diagnostically valuable than the DTC itself, identifying the conditions under which the fault occurred.
5. D — White smoke that persists after warmup and intensifies under load indicates coolant entering the combustion chamber. The coolant vaporizes to water vapor (visible as white smoke) during combustion. Common sources are head gasket failure, cracked head, or EGR cooler internal leak.
6. A — A cylinder producing no measurable RPM drop when disabled was not contributing before cutout. If it had been firing normally, disabling it would produce a measurable drop. The absence of change is diagnostic evidence that the cylinder was already inactive — fuel delivery, mechanical, or both.
7. B — A rhythmic knock at low RPM synchronized with engine firing frequency is the classic signature of rod bearing wear. At low RPM, each individual combustion impact is distinguishable, making the knock audible. Higher RPM masks the individual impacts through firing frequency overlap.
8. C — Silicon is the marker element for dirt contamination. Elevated silicon without other wear metals rising indicates external dirt is entering the engine without yet causing internal wear. A leaking air intake is the most common cause; repair prevents progression to wear metal elevation.

9. D — Inducement countdown on a derated Class 8 tractor is specifically an emissions-related enforcement action. The ECM has detected a persistent fault in the aftertreatment system (typically SCR or DEF-related) and is progressively limiting engine operation per EPA requirements. Other listed conditions do not trigger inducement.
10. A — With boost, rail pressure, and back pressure all within specification, the remaining power-loss factors are in the aftertreatment system. DPF loading, SCR function, and DEF quality can all reduce engine power output when the system forces derate or when exhaust backpressure develops downstream of measurement points.
11. B — An illuminated MIL indicates the ECM has detected a fault serious enough to require attention, regardless of driveability complaints. The root cause must be diagnosed and repaired because the fault may progress, affect emissions compliance, or indicate a developing condition. Clearing codes without repair is improper service.
12. C — Warpage of 0.009 inches against a 0.004-inch specification requires resurfacing within OEM material removal limits. If total cumulative removal stays within the manufacturer's maximum, the head can be restored. Installing with thicker gaskets or ignoring warp produces combustion leaks and gasket failures.
13. A — Modern heavy-duty diesel head bolts are almost universally torque-to-yield (TTY) fasteners. They are stretched past their yield point during installation to provide consistent clamping force. Once stretched, they cannot reliably produce correct clamp load on reuse, so OEMs require replacement after removal.
14. B — Valve rotators distribute wear evenly by rotating the valve slightly with each opening. Without rotation, the same portion of the valve contacts the same portion of the seat repeatedly, producing localized burning and uneven wear. Replacement prevents this failure mode.
15. D — Excessive valve stem-to-guide clearance allows oil to flow down the valve stem past the worn guide and also prevents the valve stem seal from functioning effectively. The result is oil consumption through the guide, visible as blue smoke, and reduced oil life.
16. A — Bent rods are typically symptoms of upstream events such as hydrolock, detonation, or severe cylinder pressure spikes. Installing a replacement rod without identifying the cause of the original bending guarantees repeat failure. Root cause investigation must precede reassembly.
17. C — Cylinder liner protrusion uniformity ensures the head gasket fire ring is crushed uniformly around the cylinder. Uneven protrusion produces uneven crush, which creates weak sealing zones that fail in service. Uniform protrusion is critical for gasket sealing integrity over engine life.
18. D — Block deck flatness requires a precision straightedge placed across the deck surface, with feeler gauges measuring any gap. This technique identifies warp in multiple orientations — longitudinal, transverse, and diagonal. Calipers, hand feel, and rulers cannot accurately measure flatness.

19. B — Out-of-round is specifically the difference between diameter measurements at perpendicular angles (typically 90°) at the same axial position. This measures cross-sectional shape distortion. Taper — the separate measurement — is the difference between axial positions at the same angle.
20. A — Monobloc forged steel pistons provide superior thermal durability because steel retains strength and dimensional stability at the high temperatures (often above 900°F at crown) that heavy-duty diesel pistons experience. Cast aluminum pistons cannot sustain these temperatures reliably in rated-load service.
21. D — Low oil pressure at idle that recovers at higher RPM is the classic signature of worn main or rod bearings. As clearance increases from wear, more oil leaks out of the bearings at low pump output (idle); at higher RPM, increased pump output overcomes the leakage to restore pressure.
22. C — Pressure loss with no external leak indicates internal leakage into the combustion chamber or crankcase. Head gasket failure and cracked head/block are the two primary paths. Combustion leak testing can confirm which internal path is losing coolant, guiding the specific repair needed.
23. A — SCA is a nitrite-based additive that replenishes cavitation inhibitor chemistry protecting cylinder liner outer surfaces. Cavitation damage occurs from coolant bubble collapse during cylinder flex; nitrite forms protective films that prevent this pitting attack.
24. D — Engine oil typically runs 10 to 20°F higher than coolant temperature at rated load. The oil absorbs heat directly from bearings, piston cooling jets, and friction surfaces that operate hotter than the coolant. This thermal relationship is normal and indicates both systems are functioning correctly.
25. B — Brown emulsion visible in the coolant surge tank is the classic signature of an internal oil cooler leak. Oil pressure exceeds coolant pressure, forcing oil into the coolant side where it floats to the top and forms a visible emulsion layer. The finding directs diagnosis specifically to the oil cooler.
26. D — Oil-in-coolant without reverse contamination is the classic signature of an oil cooler internal leak. Oil pressure normally exceeds coolant pressure, so internal leaks flow from high-pressure oil to lower-pressure coolant. Head gasket and block cracks would typically produce bidirectional contamination.
27. A — Shaft radial play double the maximum specification indicates bearing wear beyond serviceable limits. Heavy-duty turbocharger bearings wear from oil supply issues, contamination, or extended operation beyond service intervals. Turbocharger rebuild or replacement is required.
28. C — An air intake leak between the filter and turbocharger admits unfiltered dust directly to the compressor wheel. Abrasive particles erode the compressor blade leading edges and damage bearings, eventually destroying the turbocharger. This location has no secondary filtration.

29. B — A VGT stuck closed at high RPM restricts exhaust flow precisely when volume is highest. The result is excessive back pressure, potential turbocharger overspeed, and elevated cylinder pressures that can damage pistons and valves. The condition cannot be tolerated; immediate intervention is required.
30. D — Normal exhaust back pressure at rated load on a heavy-duty diesel is 3 to 5 psi maximum. Values above 5 psi indicate restriction in the exhaust system or aftertreatment. The specification provides the threshold for diagnosis of aftertreatment or exhaust path issues.
31. A — An oil-contaminated CAC will immediately contaminate any new turbocharger installed on the same engine. Residue coats internal surfaces and provides a continuous source of contamination. Cleaning or replacing the CAC before turbo installation is essential to prevent immediate re-failure.
32. C — Active regeneration is commanded when accumulated DPF soot exceeds the threshold that passive regeneration can clear. The ECM then initiates fuel dosing to raise DPF temperature high enough to burn off accumulated soot. Engine speed, ambient temperature, and vehicle speed are not primary triggers.
33. A — Lift pump output at 28 psi (well below 45–60 spec) indicates inadequate low-pressure supply, which prevents the HP pump from building rated rail pressure. The low-pressure supply must be verified and repaired first before investigating HP components. Parts replacement without addressing supply wastes time.
34. B — Both technicians are correct. EUI injectors use cam-driven plungers inside each injector to generate injection pressure locally. HEUI injectors use high-pressure engine oil acting on a hydraulic intensifier inside each injector. These defining characteristics distinguish the two injection technologies.
35. D — A water-in-fuel warning indicates water has accumulated in the separator bowl to the sensor level. Safely stopping and draining the water prevents it from reaching the fuel filter and injection system, which would cause serious damage. Continuing operation risks expensive fuel system contamination.
36. A — HPCR injectors carry unique factory calibration codes encoding individual flow characteristics. The ECM uses this code to compensate for injector-to-injector variation during operation. Without proper coding, cylinder balance faults and emissions issues develop because the ECM cannot match actual injector flow to command.
37. C — Pilot injection delivers a small quantity of fuel, typically 2 to 5 percent of total cycle fuel. The small volume is enough to initiate combustion early and raise chamber conditions, reducing ignition delay on the main injection and significantly reducing diesel combustion noise. Main injection delivers 65–85% of total fuel.

38. B — Return flow of 50 mL/min against peers at 15 mL/min represents more than triple the normal leakage rate. This indicates excessive internal leakage past worn plungers or control valves — rail pressure escapes through the return path rather than being delivered as injection. Injector service or replacement is required.
39. D — On HEUI systems, the ICP (Injection Control Pressure) sensor monitors the high-pressure engine oil supplied to the injectors. HEUI injection pressure is generated from this oil acting on each injector's hydraulic intensifier. ICP feedback allows the ECM's pressure control loop to maintain commanded injection pressure.
40. A — Biodiesel acts as a solvent and dissolves accumulated deposits in fuel tanks, lines, and filters. When switching from petroleum diesel to B20, these deposits flush through the system and collect in the fuel filter, causing premature plugging. Filter service intervals should be reduced during transition.
41. C — Primary fuel filters on heavy-duty diesels filter at 10 to 30 microns nominal. This coarser filtration captures significant contamination at high flow rates. The finer secondary filter (2–4 microns) provides final protection for high-pressure injection components; primary filters handle initial capture.
42. B — A pressure control valve stuck closed cannot bleed excess rail pressure. The HP pump continues pumping until reaching its maximum output capacity, far exceeding commanded pressure. Modern ECMs detect this overpressure condition and trigger protective derate to prevent catastrophic damage to fuel system components.
43. D — Fuel with a cloud point of 22°F will form wax crystals at any temperature below that value. In a 0°F climate, the wax progressively plugs fuel filters during cold operation. Anti-gel additives or winter blending are required to prevent wax-related operational problems in cold conditions.
44. C — Fuel density varies with temperature — hotter fuel is less dense than cooler fuel. Because injection is commanded as a volume (duration of valve open time at rail pressure), temperature-driven density changes affect the mass of fuel delivered per injection pulse. Modern ECMs compensate injection timing based on fuel temperature.
45. B — EUI injectors require cam-driven plunger motion to generate injection pressure internally. ECM solenoid control determines timing and duration of the injection event. This combination distinguishes EUI from HEUI (oil pressure) and HPCR (stored rail pressure) injection systems.
46. C — A blocked tank vent prevents atmospheric air from entering as fuel is consumed. Vacuum progressively develops in the tank, opposing fuel flow through the pickup. Initially the engine may run at low demand, but the vacuum eventually starves the engine, producing power loss and stalling.
47. B — Pilot injection occurs approximately 15 to 25 degrees before TDC to initiate combustion before the main injection arrives. This early combustion raises chamber pressure and temperature,

reducing ignition delay on the main event and significantly reducing diesel combustion noise and NO_x formation.

48. D — The common rail is the pressurized accumulator that stores fuel between injection events. The HP pump maintains rail pressure; each injector releases stored pressure when commanded. Individual injectors do not store fuel internally, and the pressure control valve regulates rather than stores pressure.
49. A — Cable voltage drop of 1.1V (against 0.5V max) indicates excessive resistance in the positive cable or its terminal connections. Battery voltage is adequate at 12.4V, so the fault is not battery-related. The resistance restricts current flow to the starter, producing slow cranking despite sufficient battery charge.
50. C — A battery at 12.0V in a pack with three others at 12.6V shows lower open-circuit voltage indicating a possible cell failure or significant capacity degradation. The 0.6V difference is substantial and will degrade overall pack performance. Load testing confirms weakness; replacement is recommended.
51. B — When the starter armature spins freely without cranking the engine, the drive mechanism has failed to transfer rotation to the flywheel ring gear. The pinion, Bendix drive, or shift fork is worn or damaged. Battery, regulator, and fuse issues would prevent armature rotation entirely.
52. C — AC ripple reading 8 times above specification is the classic signature of failed rectifier diodes. Each failed diode allows AC to pass through to the DC output. Elevated ripple damages sensitive electronic components throughout the vehicle, especially ECM circuits.
53. C — Compression-release engine brakes use engine oil pressure to hydraulically actuate the master and slave piston circuit. The master piston (driven by a dedicated cam lobe) displaces oil through the circuit to the slave piston, which pushes the exhaust valve open near TDC. Adequate oil pressure is essential for the mechanism.
54. A — Exhaust brakes use a butterfly valve in the exhaust piping to restrict flow, creating back pressure that the piston must pump against during the exhaust stroke. The pumping work absorbs drivetrain energy. The mechanism is simpler than compression-release brakes but generally produces less braking power per cylinder.
55. B — Dashboard brake levels (LOW, MEDIUM, HIGH) control the number of cylinders activated for compression-release braking. LOW typically engages 2 cylinders, MEDIUM 4, and HIGH all 6 on a six-cylinder engine. Each level adds cylinders to progressively increase braking effort for different driving conditions.